

# **ZyPer Management Platform Release Notes**

Software 2.5.37610

June 15, 2022

# **Revision History**

Date	Version	Fixes/Changes
May 25, 2022	2.5.37604	General Availability release
June 15, 2022	2.5.37610	Labeling Fix for EDIDs and new info on 5Volts
July 12, 2022	2.5.37610	Added Utility Port fix under Issues Resolved

## Contents

κeν	rision history	I
1.	Supported platforms	2
2.	New features	3
3.	Issues resolved	3
4.	Issues Outstanding	4
5.	Known limitations	6
6.	Current device firmware	9
F	irmware capability	9
7.	API Additions, changes, and deletions	10
Δ	dditions	10
	ZyPerNG and ZyPerXS/XR productCode and productDescription	10
C	Changes	11
	Fixed receiving video and receiving audio status outputs	11
8.	Upgrading and Downgrading	12
App	pendix A New Features	17
Ν	lew Device Support and Device Enhancements	17
	Support for ZyPerXR devices	17
	Enhancements to break out Netgear modules to their own product group ZyPerNG	17
Z	yPerUHD Image Upload GUI Support	18
Z	yPerUHD Universal Firmware Versioning	20
C	ross Platform Redundancy Support	24
App	oendix B New CamelCase Replaces Hyphenated Formatting (Introduced in ZMP v2.2 release)	26
	Overview	26
	CamelCase Commands – 100% Backward Compatible	27
	CamelCase Show Output	27

### 1. Supported platforms

### **ZyPer Management Platform**

- VMWare ESXi appliance on Ubuntu v14.04.2
- VMWare ESXi appliance on Ubuntu v16.04
- ProServer on Ubuntu v16.0.4
- Gigabyte NUC (Generation 1 Rev A) on Ubuntu v14.04.2
- Intel NUC (Generation 2 Rev C and Generation 3 Rev D) on Ubuntu v16.0.4
- Simply NUC (Rev E) on Ubuntu v20.04

### **ZyPer Management Platform GUI web interface**

• Google Chrome

### **Encoders and decoders**

- ZyPer4K HDMI 2.0 encoders and decoders
- ZyPerXR HDMI 2.0 encoders and decoders
- ZyPerXS HDMI 2.0 encoders and decoders
- ZyPer4K Netgear Module encoders
- ZyPerUHD encoders and decoders
- ZyPerUHD wallplate encoders
- ZyPerUHD Dante encoders
- ZyPerHD encoders and decoders (Last Release supporting ZyPerHD units)
  - NOTE: Version 2.3.x was the last version ZyPerHD devices were supported in the ZyPer Management Platform. If after updating you are no longer able to manage the ZyPerHD device, please revert the ZyPer Management Platform to the previous version.
- ZyPerXS HDMI 2.0 1.3.2.4
- ZyPerXR HDMI 2.0 1.3.2.4
- ZyPerUHD 1.18 (New firmware process)
  - All hardware versions are now updated with the unified \*.UP1 file
- ZyPerUHD Dante Encoder 1.18 (New firmware process)
- ZyPer4K HDMI 2.0 4.1.2
- ZyPer Netgear Module Encoders 4.0.0.6

### Please note For ZMP versions before 2.5 please read the following:

For second-generation UHD devices, use the firmware update file with the ".bin2" file extension. First-generation and second By un-joining generation hardware can be determined by the device MAC address.

- For MAC addresses that begin with: 34:1b:22 use the file extension .bin
- For MAC addresses that begin with: 6c:df:fb use the file extension .bin2

In addition, the "ZyPerUHD Dante encoders" will still use the first-generation firmware updates.

### 2. New features

#### **MP Server**

- Enhanced Support for ZyPerNG
- Added Support for ZyPerXR
- Cross Platform Redundancy
- 5 Volt Control added to ZyPerXS/XR (Requires Endpoint Firmware 1.3.2.4
- 5 Volt Control for ZyPer4K Display Port Decoders (Toggle enabled/disabled available)

### MP GUI

- Support for ZyPerXR
- Breakout of ZyPerNG to its own platform
- Support for ZyPerXR Join Config
- ZyPerUHD Idle Screen Upload
- ZyPerUHD Universal Firmware Updates

### Bug Fixes in this release

Resolved multiple issues in this version see section 3 "Issues resolved"

### **End of ZyPerHD support**

### Reminder: As of the 2.3.x release

• Release 2.3.x will be the final release to support ZyPerHD

### Reminder: As of the 2.2 release

- ZyPer Management Platform Mobile mode (no longer supported)
- ZyPerUSB is no longer supported as a device (removed for this version)

### 3. Issues resolved

Component	Issue	Other
MP Server	Multicast address allocation crash fix	
MP Server	cURL not-really-thread-safe workarounds	
MP Server	Utility Port settings were misread, causing Disable commands to be	
	ignored. As a upgrade note, ZyPer4K Utility ports could become	
	inaccessable as the MP will now enforce the disabled settings.	
ZyPerUHD V1&V2	ZyPerUHD Firmware update brick fix	
ZyPer4K/XR/XS	hdmiAudio status is not correct when no video connection	
MP GUI	Zone display mix of Z4K and XS (and XR)	
ZyPerUHD V1&V2	Down device issue ZyPerUHD causes rcServer to crash	

ZyPer4K/XR/XS	HDMI disconnect on encoder does not change the decoders video	
	state	

## 4. Issues Outstanding

Component	Issue	Workaround
ZyPer4K HDMI 2.0	Fast Switched joins at 480I/576I display video in an improper ratio horizontally	No workaround is available at this time.
ZyPer4K HDMI 2.0	ZyPer4K Charlie - Encoder - Incorrect FPS status (cosmetic) under 420 color formats	No workaround is available at this time.
ZyPer4K HDMI 2.0 Dual HDMI	ZyPer4K Encoder Dual HDMI input - Using an Apple 4K source, I found that UHD 60 YUV 420 8bit video is not seen on the loop out or on the decoder display	No workaround is available at this time.
ZyPer4K HDMI 2.0 Analog Expansion	If there is an active HDMI connection to the encoder and nothing is connected to the S-video port, the analog cable status shows connected and with the last S-video resolution.	No workaround is available at this time.
ZyPerUHD	ZyPerUHD - HDCP is not reported on the UHD encoders. Also, it allows video traffic to flow to devices that do not support the HDCP version used.	Restart or reboot the encoder to gain the correct information.
ZyPerUHD	ZyPerUHD - Decoder - UHD 60 8 bit 420 - When connecting a UHD60 encoder to a Decoder with a display that has only 1080 support, when rebooting the device, it does not always return video	After about two minutes the video comes back.
ZyPerUHD	There is a known issue with ZyPerUHD video walls above 3X3. Changes to an active video wall of sizes larger than 3X3 cause fluctuations in the video under all screens of the wall for up to 5 minutes before stabilizing.	This only happens on a modification to the video wall configurations. Unjoining all screens of the video wall with the disconnect to the video wall clears all the video. Then changes to the wall's config can be made, followed by a rejoining of the encoder to the wall.
ZyPerHD	In the ZMP GUI under the config of the encoder, the ZyPerHD Encoder shows it supports the new compressed audio option for the EDID. This feature is not supported on the ZyPerHD.	Feature if selected will do nothing as the devices have a hard-coded EDID.
MP - Server	Encoder videoScaledStream stays enabled even when it was not used in Multiview mode	By un-joining all the other video connections involving the encoder that you are trying to connect with will clear this state. Then re-join the encoder to the same decoder in fast-switched mode.
MP – NUC	Power off via Shutdown command on the 1 <sup>st</sup> generation NUCs does not shut down the server.	Manual power off on the NUC power button is required to shut it off.
Multiview	When removing an encoder that is assigned to multiple Multiview windows in the same configuration, the video will not be removed	Deleting the window will need to be done in the API to remove the video from the proper display window.

	T 16	T
	until the encoder is removed from all	
	windows	
ZMP GUI –	Cannot join HDMI audio separately in the GUI	Use the API to set audio separately.
ZyPerUHD -	for ZyPerUHD devices. Instead of a Join, the	
Analog Audio	GUI sends a disconnect for analog audio for	
	the device.	
ZMP GUI -	Encoder Window, sound, and status are not	Checking the API is required to see the sound
Multiview	indicated under the ZMP GUI Multiview	source for the Multiview config.
	config. The icon for the sound source of the	
	Multiview does not show active sound if the	
	window is selected for sound source and	
	saved.	
ZMP GUI -	Edit menu- The pattern button still resizes	Click the resized button to access the drop
Multiview	when you click on the bottom 3 <sup>rd</sup> of the	down menu.
	button when in a Multiview single panel	
ZMP GUI - Source	On occasion, the custom config containing	Close the browser and restart it if this gets into
	"disconnect" actions will show no actions	this state.
	after saving the config.	
ZMP GUI -	When you first upgrade from 1.7.4 or 1.8 the	Edit the Join config for the fast switch and add
Upgrade - ZUHD	ZyPerUHD shows the Join config for Fast	the audio to the configuration or select to reset
	switched without the Audio. In 2.0 and 2.1	to defaults to receive the new join config.
	this is now required to get Audio to connect	
	when using the GUI	
ZMP Downgrade -	If a downgrade from 2.3 to 2.2 is done,	Use Revert if a downgrade is needed to 2.2
Video Wall	decoders assigned to video walls will be	
	unassigned.	
Preview	The preview video has vertical lines in the	No workaround is available at this time.
	video on some encoders.	
Save System	Some system configurations like presets are	No workaround is available at this time.
config	not saved out of the system config.	
Save System	Some commands are saved out of order like	No workaround is available at this time.
config	Multiview "create" and "set" commands	The first out of the standard of this time.
MP – Does not	If the MP is powered on and is set for DHCP	A reboot of the server will allow it to get the
obtain DHCP IP	but the Switch or Switch connection is not up,	DHCP address.
	the server will fail to get the DHCP address	Sile address.
	once it comes back online	
	Office it comes back offillie	

## 5. Known limitations

## ZyPerXS HDMI 2.0

Component	Limitation	Workaround
Encoder	No Overlay is available for this product.	Working as Designed
Encoder -	HID USB is available only on this product, USB	Working as Designed
Decoder	is not compatible with ZyPer4K HDMI 2.0 units.	
Encoder -	If the ZyPer encoder or decoder is connected to	Delete the device and the units will be added
Decoder	the MP system network before the upgrade,	back in properly. This is true for Decoders as
	the units will show up as decoders after the	well to gain full functionality.
	upgrade to 2.2 and above.	

## ZyPer4K HDMI 2.0

Component	Limitation	Workaround
Decoder	When swapping HDMI from ZyPer4K decoders with the HDMI unplugged for less than 5 seconds, the decoder fails to read the new EDID.	When power cycling or unplugging, wait 5 seconds before plugging the unit back in.
Decoder - Display port board variant	When Display port connections to a Monitor or TV that are set to 3840 X 2160 60 FPS 8 bit 444, the video has been seen to stop and start again after a link training has been established. It is not every time and in testing varies depending	To work around this problem, the following guidelines must be implemented to obtain reliable 3840 X 2160 60 FPS during these particular instances of fault.
	on particular environment variables as up to 1 out of every 5 link training events. The event itself is specific to a disconnect of the Display Port connection or power event of the end	For Genlocked connection, sources must be using reduced blanking timing, limiting pixel clock to 550MHz.
	points.	Fast-switched connections may also be used as the method of joining the Encoder to the Decoder.
		The advanced timing command must be used to configure the decoder for use:
		set decoder decoder_name   decoder_mac display- advanced-timing sync-front-porch 48 2 sync-width 32 5 hsync-polarity auto vsync-polarity auto total- size 4000 2222

Encoder – SDI	Genlocked mode – Audio is limited to 2	None
board variant	channel supports	
Encoder - Analog Board variant	During connections using the VGA port on the expansion board, audio may not be available for the connection. This occurs one out of every 15 to 20 connects using the VGA port on this device.	We have found that resetting the port to HDMI and then back to VGA does resolve the issue.
Multiview	Resolution of 2560 X 1440 is not supported for the Multiview window	None
Multiview	Custom Multiview containing two windows above 2048x1080 fails to join window to the decoder	None

## ZyPerUHD

Component	Limitation	Workaround
Decoders	When the UHD Decoder is downscaling from UHD 3840 X 2160 60 420 8 bit to 1080P 60 on a display, if a reboot (power cycle or restart command) occurs to the Decoder the Display will not return video.	To recover from this state the device needs to be rejoined to display video once more.
Decoders - CEC off on	It has been found that on some Samsung displays, the CEC "on" command will not return the monitor to an active state. One monitor that experienced this issue was a Samsung 4K UN40JU6500. To activate the TV after encountering this event, a power on must be done.	A power Cycle of the TV is required
Decoders - Sleep mode	In addition, when using the sleep mode feature to set the display to sleep (regardless of the decoder connections) displays require a 10-second window if the user wants to disable this mode.	A power reset of the Decoder will be required
Encoder	HDCP, interlacing state, Bit sample, Color Space, and Color Format states may not report correctly on UHD encoders  • HDCP status – May not report correctly • Interlacing State – Will always show "no" • Color Space – Will always report 444 • Color Format – Will Always report RGB Color bit depth –always reports 8 bit	None
Encoder	Under the Encoder information output the EDID used for the encoder may not match the decoder it is joined to. This is part of the design, as the system will load an EDID that it feels is most compatible. This could be an EDID that is either stored in its database or from an	Working as designed

	active decoder that shares the encoder's	
	connection.	
Independent	Joins of Audio between the encoder and the	None
Audio routing	decoders or changes in the audio to the	
	decoder will cause a 1 to 2 second video	
	interruption. This is because of an internal	
	modification of this connection.	
Audio Limitation	The audio for the Decoder's HDMI and Analog	None
	out port is limited to only one source of the	
	Encoder's audio.	
Independent IR	Due to the implementation of independent IR	None
routing	joins from device to device. We are no longer	
	able to receive IR from the device to the	
	server.	
Resolution	Resolution Support for ZyPerUHD does not	None
Support	support 4096 resolutions and will not produce	
	resolutions at 3840 X 2160 50 FPS/60 FPS. The	
	ZyPerUHD encoder will not recognize any video	
	above 3840 X 2160 60 FPS YUV 420, 8 bit (in	
	either bit rate or color format).	
RS232	Changes to the RS232 configuration to support	It is no longer required to reset the endpoint
Configuration and	the endpoint-to-endpoint communication	for device-to-device communication, only when
routing	require the devices to be restarted. Changes to	going to or from device to server does the
	the baud rate, connection endpoints, and	device reset. RS232 config changes still reboot
	other rs232 communication will restart the	the device when made.
	device.	

### **ZyPer GUI**

Component	Limitation	Workaround
After Upgrade	After upgrading to 2.3, the connection tooltips under the Display Panel Icons show only video connected.	A refresh of the GUI will show all connections on the Display Panel Icons
Thumbnail	When starting Thumbnail videos, sometimes the icons show a pinwheel instead.	A stop and start of the thumbnail video by clicking on the Icon will remedy this issue. Alternatively, a refresh of the GUI will show all the videos enabled.
Video wall	If a name of a Decoder is changed and the video wall that contains said decoder is then opened for editing, the Decoder will no longer be present under the configuration.	After the Decoder name is changed but before the video wall is opened for edit, a refresh can be done. Then the video wall will contain the Decoder with the changed name.

## ZMP Redundancy and VMWare

Component	Limitation	Workaround
ZMP with dual	Setting the Management Interface (eth1) on a	To correct this, the user should enter the ZyPer
NICs	ProServer or a dual NIC NUC ZMP device to an	Management Platform under the "Video-
	IP not accessible to the originating ZyPer	Network" IP from a device on that network and
	Management Platform Source machine could	correct the Management NIC interface address.
	cause an inability to access the Management	
	port after it is set.	

ZyPer	Starting in the upgrades to 1.8, VM Hosted	None
Management	ZMPs require the use of the update_vm to	
Platform –	upgrade to 1.8 and beyond. Reverting to 1.7X	
VMWare updates	and 1.6 versions are possible through the use	
	of the standard update_nuc file if needed.	
VMware	There is no support for virtual machines	None
Redundancy	hosting the ZMP image under 1.8, only single-	
Support	server deployments are supported.	

## 6. Current device firmware

Device	File version
ZyPer4K HDMI2.0	4.1.2
ZyPerXS HDMI2.0	1.3.2.4
ZyPer Netgear Encoder Module	4.0.0.6
ZyPer4K HDMI1.4	2.10.x
ZyPerUHD Encoders and Decoders	1.18
ZyPerUHD Wallplate Encoders	1.18
ZyPerUHD Dante Encoders	1.18
ZyPerHD* Encoders	2.12.3
ZyPerHD* Decoders	2.12.4

<sup>\*</sup> Release 2.3.x will be the final release to support ZyPerHD

### Firmware capability

<b>Endpoint Firmware</b>	MP 1.8	MP 2.1	MP 2.1.1	MP 2.2	MP 2.3	MP 2.3.1	MP 2.4	MP 2.5
ZyPer4K 3.5.2	Х							
ZyPer4K 4.0.0.X	Х	Х	Х					
ZyPer4K 4.0.1.0		Х	Х					
ZyPer4K 4.1.0				Х	Х	Х	Χ	Х
ZyPer4K 4.1.2					Х	Х	Х	Х
ZyPerNG 4.0.0.6				X	Х	Х	X	X
ZyPerXS/XR 1.2.0.2					X	X	X	X
ZyPerXS/XR 1.3.2.0								Χ
ZyPerXS/XR 1.3.2.4								X
ZyPerUHD up1.1.5	X	X	X					
ZyPerUHD up1.1.6	Χ	X	X					
ZyPerUHD up1.1.7	Χ	X	X					
ZyPerUHD up1.1.8		X	X					
ZyPerUHD up1.1.9		X	X	Χ				
ZyPerUHD up1.1.10		Х	Х	Х				
ZyPerUHD up1.1.11				Х				
ZyPerUHD up1.1.12				Х				
ZyPerUHD up1.1.13				Χ				
ZyPerUHD up1.1.14				Х				

ZyPerUHD up1.1.15		Χ	Χ	Χ	Х	
ZyPerUHD up1.1.16		X *	X *	X *	X *	Χ
ZyPerUHD up1.1.17		X *	X *	X *	X *	Χ
ZyPerUHD up1.1.18						Χ
* Hot Fix Only						

Note: 1.13 is the minimum level that should be applied to ZyPerUHD2 hardware due to hardware changes that will not be compatible with lower firmware versions.

### 7. API Additions, changes, and deletions

### Additions

### ZyPerNG and ZyPerXS/XR productCode and productDescription

In this release, the NG and XS/XR devices are officially labeled under the Product and Model fields under the device Config and Status output.

### **Status and Config Output**

#### NG Encoder

o device.gen; productCode=Z4KNGENC4, productDescription=HDMI 4-Port Netgear M4300, pid=0xa

### XS Copper Encoder

- o Product ID 14
- o device.gen; productCode=Z4KENCCXS, productDescription=Copper Encoder HDMI 2.0, pid=0xe

### XR Copper Encoder

- o Product ID 24
- device.gen; productCode=Z4KENCCXR, productDescription=Copper Encoder HDMI 2.0, pid=0x18

### • XR Fiber Encoder Short Range

- o Product ID 20
- o device.gen; productCode= Z4KENCFSXR, productDescription=SR Fiber Encoder HDMI 2.0, pid=0x14

### • XR Fiber Encoder Long Range

- o Product ID 22
- o device.gen; productCode= Z4KENCFLXR, productDescription=LR Fiber Encoder HDMI 2.0, pid=0x16

### XS Copper Decoder

- o Product ID 15
- device.gen; productCode=Z4KDECCXS, productDescription=Copper Decoder HDMI 2.0, pid=0xf

### XR Copper Decoder

- o Product ID 25
- device.gen; productCode=Z4KDECCXR, productDescription=Copper Decoder HDMI 2.0, pid=0x2

### • XR Fiber Decoder Short Range

- o Product ID 21
- o device.gen; productCode= Z4KDECFSXR, productDescription=SR Fiber Decoder HDMI 2.0, pid=0x15

### • XR Fiber Decoder Long Range

- o Product ID 23
- o device.gen; productCode= Z4KDECFLXR, productDescription=LR Fiber Decoder HDMI 2.0, pid=0x17

### Changes

### Fixed receiving video and receiving audio status outputs

In this release there are changes to the receivingVideoFromEncoder and receivingAudioFromEncoder fields under the ZyPer4K/XS/XR Decoders.

### receivingVideoFromEncoder

In prior versions, this field would remain "yes" if the encoder that was connected to this decoder lost its HDMI connection. The result would be seen on the ZMP GUI Display Tab which would show the Decoder in question remains in a Green State.

In this version, we have corrected this behavior and if the connected Encoder loses its HDMI signal the Corresponding Decoders will reflect the proper state under the receivingVideoFromEncoder field of "no" and the ZMP GUI Display will show in a yellow state.

### receivingAudioFromEncoder

In the prior version, if hdmipassthrough audio was connected without video, this field would show "no" This was under the ZyPer4K/XS/XR Decoders.

In this version, we have corrected this to show "yes" under this configuration.

Misc

Factory Default changes for RS232– Through the versions of ZMP 1.8 to 2.1, when ZyPerUHD devices are reset to default the following default baud rates will be applied.

- In 1.8 the default is 38400
- In 2.0 the default is 9600
- In 2.1 or later the default is 115200

### **Deletions**

No API command deletions in this release.

For more information on API command changes introduced in the ZMP v2.5 release, please see page 17 of this document.

## 8. Upgrading and Downgrading

### Unique update files are required for each platform

Starting with release v1.8, the ZyPer MP update file will be available in three, platform-specific versions. Please use the correct version for the hardware platform being updated.

### File name examples:

- ZyPerMP NUC computer: update\_nuc\_2.5.37604.zyper
- ZyPerMP Proserver: update\_proserver\_2.5.37604.zyper
- ZyPerMP VMware: update\_vm\_2.5.37604.zyper
- ZyPerMP Simply NUC: update\_nuc2004\_2.5.37604.zyper

### Known issues with upgrading and downgrading

Affected	Issue	Affected Hardware	Workaround
Versions			
Moving to 1.7.4 from prior versions	The ZMP Generation 2 can only be upgraded through the service rcServer update command	ZMP NUC generation 2	The process is shown below From the ZMP OS command line perform the below commands.
			sudo service rcServer stop sudo service rcServer update /srv/ftp/files/update
Moving back to	The ZMP Generation 3 comes installed	ZMP NUC	If downgrading, you will need to
1.7.4 after being	with 1.7.4.33922 pre-installed and is	generation 3	go to 1.8.34961
upgraded	upgradable. However, in a downgrade		
	scenario after an upgrade, it cannot be		
	downgraded to anything less than 1.8.34961		
Downgrading to	Downgrading to the 1.7.1X version of	ZMP NUC	Clearing the browser Cache
1.7.1	the software will require the user to	generations 1 and 2	
	clear the cache to see the "Roles or		
	Users" panel.		
Upgrading from	There is reduced support for	ZMP NUC	1.3 and 1.4 versions should be
a version prior to 1.6	downgrading due to the extensive additions to the newer versions. In	generations 1 and 2	upgraded to 1.6 before upgrading to the new releases
10 1.0	particular, the 1.3 to 1.4 versions		to the new releases
	require additional steps to recover		
	from the change in database tables,		
	fields, and features that are not		
	present at the time of the original		
	version.		
Upgrading to	1.5.2 cannot upgrade to releases	ZMP NUC	Upgrading to 1.6 first will allow
1.6 and above	above 1.7.X through the GUI due to	generations 1 and 2	GUI upgrades. Alternatively
	the file size limitations of the new		upgrading using the API will work
Devemon eliza e 4	release.	ZMP NUC	as well.
Downgrading to 1.6 or 1.5.2	If downgrading to 1.5.2 or 1.6, you		Clearing the browser cache
1.0 01 1.5.2	may have to clear the browser cache before logging back into the MaestroZ	generations 1 and 2	
	An error may occur in the browser		
	alerting you to a cert error, this was		
	arer error, triis was	<u> </u>	

	actually due to the login to the REST server (which is not present on versions prior 1.7.X), the browser may maintain this login path on the next login until the cache is cleared.		
	i T		21/2
Downgrading to	If downgrading to either 1.5.2 or 1.6,	ZMP NUC	N/A
1.6 or 1.5.2	the user in MaestroZ will not be able	generations 1 and 2	
	to add zones. This is due to the		
	"datetime" format change in the zone		
	table when Maria DB replaces MySQL.		
	Reverting keeps Maria DB thus the		
	command sent to create the zone fails		
	because of the format mismatch of		
	the datetime.		
Upgrading to	If ZyPer4K units exist on the network	All Platforms	Deleting these devices in the API
2.2	and are available to the MP before		or GUI will allow the system to
	upgrading to 2.2, these devices will		discover them properly.
	show up as decoders only and not		
	contain all functionality.		
Upgrading to	When adding ZyPerXS units to an	All Platforms	Resetting the Join config to factory
2.2	existing system it is necessary to set		defaults – will need to do this on a
	the Join Config to factory defaults in		ZyPer4K Source Icon.
	order to generate a valid Join Config		,
	for the XS units.		
Downgrading to	There is a known issue where the	All Platforms	Using the revert function to go
2.2 from 2.3 GA	video wall decoders will become		back to 2.2 will avoid this issue.
	unassigned		Use of revert is always preferred.
	_		

**Other Notes:** Beginning in 1.7.4 there is a saved file that includes the export from the database before an update. This file can be used to restore the database to the state it was in before the upgrade. The file is called: zyper.zyperversion.sql and resides on the ZMP under the folder: /srv/ftp/files. Where "zyperversion" is the version, the system was on before the upgrade.

### For versions prior to 1.8, please follow the below upgrade path

Starting Version	Jump 1	Jump 2	Jump 3	Jump 4	Jump 5	Jump 6
1.1.X	1.3	1.6	1.7.4	2.1	2.3.1	2.5
1.2.X	1.3	1.6	1.7.4	2.1	2.3.1	2.5
1.3.X	1.6	1.7.4	2.1	2.3.1	2.5	
1.4.X	1.6	1.7.4	2.1	2.3.1	2.5	
1.5.2.X	1.6	1.7.4	2.1	2.3.1	2.5	
1.6.X	1.7.4	2.1	2.3.1	2.5		
1.7.4.X	2.1	2.3.1	2.5			
1.8	2.1	2.3.1	2.5			
2.0	2.1	2.3.1	2.5			
2.1	2.3.1	2.5				
2.1.1	2.3.1	2.5				
2.2	2.5					
2.3	2.5					
2.3.1	2.5	·				
2.4	2.5					

### Upgrade and downgrade support for the following platforms of the management server

- ZMP Generation 1
- ZMP new Generation 2 and 3
- VMware
- ProServer

### Interface IP type and internet state

- Interface IP Mode: Defines how the interface acquired its IP
- Internet Access Available? Defines whether the server can reach the outside internet

### • ZMP GigByte NUC (Generation 1)

Version Prior	Interface IP	Internet Access	Result of upgrade and downgrade
Upgrade	Mode	available?	to and from this release
2.2.36791	DHCP	Yes	Passed
2.2.36791	DHCP	No	Passed
2.2.36791	STATIC	Yes	Passed
2.2.36791	STATIC	No	Passed
2.2.36791	Link Local	No	Passed
2.3.37103	DHCP	Yes	Passed
2.3.37103	DHCP	No	Passed
2.3.37193	STATIC	Yes	Passed
2.3.37103	STATIC	No	Passed
2.3.37103	Link Local	No	Passed
2.3.1.37395	DHCP	Yes	Passed
2.3.1.37395	DHCP	No	Passed
2.3.1.37395	STATIC	Yes	Passed
2.3.1.37395	STATIC	No	Passed
2.3.1.37395	Link Local	No	Passed

### INTEL NUC Celeron ZMP (Base Installed Version is 1.7.4.33922) Generation 2

(In the prior release notes this generation 2 was labeled Pentium, this was a type-o as this generation was a Celeron processor)

Version	prior	Interface IP	Internet Access	Result of upgrade and downgrade
upgrade		Mode	Available?	to and from this release
2.2.36791		DHCP	Yes	Passed
2.2.36791		DHCP	No	Passed
2.2.36791		STATIC	Yes	Passed
2.2.36791		STATIC	No	Passed
2.2.36791		Link Local	No	Passed
2.3.37103		DHCP	Yes	Passed
2.3.37103		DHCP	No	Passed
2.3.37193		STATIC	Yes	Passed
2.3.37103		STATIC	No	Passed
2.3.37103		Link Local	No	Passed

2.3.1.37395	DHCP	Yes	Passed
2.3.1.37395	DHCP	No	Passed
2.3.1.37395	STATIC	Yes	Passed
2.3.1.37395	STATIC	No	Passed
2.3.1.37395	Link Local	No	Passed

## • INTEL NUC Pentium ZMP (Base Installed Version is 1.7.4.33922) Generation 3

Version prior	Interface IP	Internet Access	Result of upgrade and downgrade
upgrade	Mode	Available?	to and from this release
2.2.36791	DHCP	Yes	Passed
2.2.36791	DHCP	No	Passed
2.2.36791	STATIC	Yes	Passed
2.2.36791	STATIC	No	Passed
2.2.36791	Link Local	No	Passed
2.3.37103	DHCP	Yes	Passed
2.3.37103	DHCP	No	Passed
2.3.37193	STATIC	Yes	Passed
2.3.37103	STATIC	No	Passed
2.3.37103	Link Local	No	Passed
2.3.1.37395	DHCP	Yes	Passed
2.3.1.37395	DHCP	No	Passed
2.3.1.37395	STATIC	Yes	Passed
2.3.1.37395	STATIC	No	Passed
2.3.1.37395	Link Local	No	Passed

### • SIMPLY NUC Celeron ZMP (Base Installed Version is 2.4.37311) Generation 4

Version p	orior	Interface IP	Internet Access	Result of upgrade and downgrade
upgrade		Mode	Available?	to and from this release
2.4.37311		DHCP	Yes	Passed
2.4.37311		DHCP	No	Passed
2.4.37311		STATIC	Yes	Passed
2.4.37311		STATIC	No	Passed
2.4.37311		Link Local	No	Passed

## • ProServer (Base Installed Version is 1.8.34703)

Version	prior	Interface IP	Internet Access	Result of upgrade and downgrade
upgrade		Mode	available?	to and from this release
2.2.36791		DHCP	Yes	Passed
2.2.36791		DHCP	No	Passed
2.2.36791		STATIC	Yes	Passed
2.2.36791		STATIC	No	Passed

2.2.36791	Link Local	No	Passed
2.3.37103	DHCP	Yes	Passed
2.3.37103	DHCP	No	Passed
2.3.37193	STATIC	Yes	Passed
2.3.37103	STATIC	No	Passed
2.3.37103	Link Local	No	Passed
2.3.1.37395	DHCP	Yes	Passed
2.3.1.37395	DHCP	No	Passed
2.3.1.37395	STATIC	Yes	Passed
2.3.1.37395	STATIC	No	Passed
2.3.1.37395	Link Local	No	Passed

### VMWARE ESXi 14.04

• VMWare ESXI Rev2 for 16.04 – (2.2 Initial Release)

Version prior	Interface IP	Internet Access	Result of upgrade and downgrade
upgrade	Mode	available?	to and from this release
2.2.36791	DHCP	Yes	Passed
2.2.36791	STATIC	Yes	Passed
2.3.37103	DHCP	Yes	Passed
2.3.37103	STATIC	Yes	Passed
2.3.1.37395	DHCP	Yes	Passed
2.3.1.37395	STATIC	Yes	Passed

### Appendix A New Features

The following new features were added to the 2.5.37604 release to enhance several areas valued to our customers.

This Appendix provides a basic overview of the new features for this release, there is an explanation of most of the command set for each newly added item(s). However, for further details on these new features and a full listing of the command's subset, please reference the "ZyPer Management Platform User Manual" for the 2.5.37604 GA release.

New Device Support and Device Enhancements

Support for ZyPerXR devices

### Components: ZyPerXR Devices, Firmware, ZyPer Management Platform API, and GUI

**Overview**: In this version, we have added official support for ZyPerXR copper, fiber SR (short range), and fiber LR (long range) units. This is the latest hardware which is designed for rugged use and offers the same capabilities as the ZyPerXS product.

### **Changes include:**

- New Product Identification under config and status outputs
- Added API capabilities to correspond with the ZyPerXR components
- GUI support for ZyPerXR features and functions
- GUI Display Icons will be labeled "XR" for the corresponding units
- A Set of Default Join Configs for the ZyPerXR

For more information on the ZyPerXR, please visit the below link for more information

https://www.zeevee.com/products/av-over-ip/encoders-decoders/zyper4k-xr/

Enhancements to break out Netgear modules to their own product group ZyPerNG

Components: ZyPer Management Platform API and GUI

**Overview:** In this version, we have broken out the ZyPerNG out from under the ZyPer4K platform so that the capabilities of the device are defined specifically for the ZyPerNG encoders.

### **Changes include:**

- New Product Identification under config and status outputs
- Refined Capabilities to correspond with the ZyPerNG
- GUI Breakout of the Units to specific Source and Display Icon Labeling "NG"
- A Set of Default Join Configs for the ZyPerNG

 Refined Join Configuration settings to Prevent Analog Audio input and USB/RS232 connections from the ZyPerNG

### Appearance:


#### **Product Code**

device.gen; productCode=Z4KNGENC4, productDescription=HDMI 4-Port Netgear M4300, pid=0xa

#### **GUI Icon**



### **Default Join Configs**

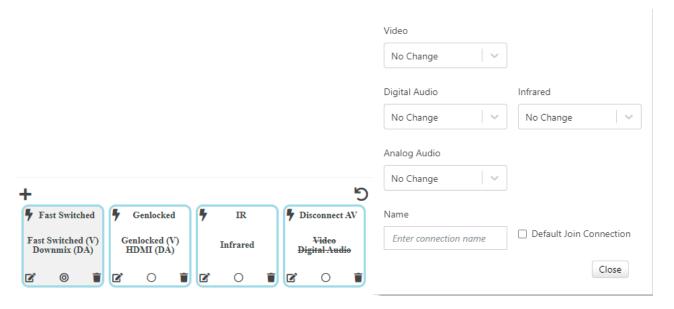

### ZyPerUHD Image Upload GUI Support

### **ZyPerUHD Idle Image load**

**Components: GUI** 

**Overview**: In this release, we support the ability to upload to the ZyPerUHD Decoder an idle image. This process replaces the Standard Zeevee Idle Screen of the UHD decoder with a custom Idle screen that the user can define. This is done in the Display Grid, under the Config tab, selecting the "IdleImage" field and populating it with the custom jpg file. When the upload is completed, the device will reset and the new idle screen will be available.


Operation: To upload a new idle image follow the below steps

File requirements are as follows

• jpg format

### Image maximum size


- 1280 Pixels Length
- 720 Pixels Height

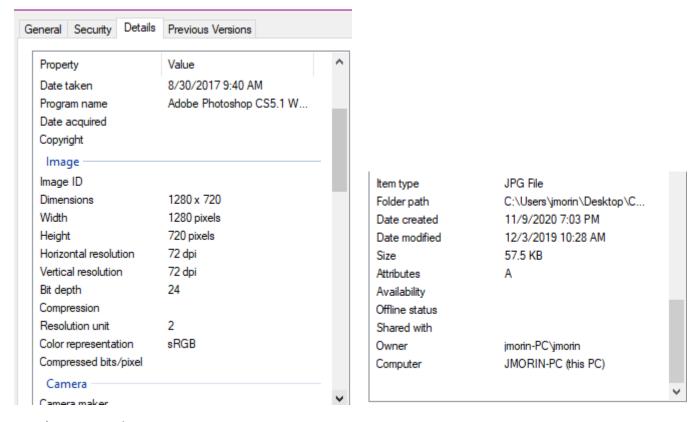

- 1) Log in to the GUI
- 2) Open the Display Grid Panel
- 3) Select the "Config" tab
- 4) Select the "IdleImage" Drop down on the Decoder you want to replace the image



 - 5) Select an Upload file
- 6) Drag and Drop or Browse to the file you want to upload.



- 7) Select "OK"
- 8) Click on "Apply"

The idle image should load and the decoder will reboot.

### **Standard Idle Image**



### **Custom Idle Image**



ZyPerUHD Universal Firmware Versioning

Components: Server API, GUI

Overview: In this version, we are introducing a new firmware versioning for ZyPerUHD version 1 and Version 2 devices. The versioning will contain a set of endpoint firmware for Version 1 and Version 2 Encoders and Decoders in a single package. We have created 18 packages to start with to span the supported combinations of Encoders and Decoders. The up1. package will replace the standard .bin and .bin2 formats, which will no longer be able to be loaded from the server to the endpoints. Updating can be done using the package under the same processes used prior to this version (GUI Source/Display Details, Device Grid Firmware Tab, or from the API with the "update device" command).

The breakdown of these versions and supported ZMP revisions are listed in section 6 under Firmware Capability.

**Operation:** 

### Updating the ZyPerHD devices can be done in the following ways

**Example of the update file format: update\_zuhd\_1.18.up1** ← 1.18 is the version that will show under the API Config output and under the GUI Firmware version.

#### API:

update device deviceName | deviceMAC packageName

#### **GUI**

- Drag and drop or Browse Source/Display Device Details Actions Update Device Firmware
- Drag and drop or Browse Source/Display Grid Firmware tab

### Appearance:


Zyper\$ show device config 2a device(34:1b:22:f1:23:2a);

device.gen; model=ZyperUHD, type=decoder, virtualType=none, name=34:1b:22:f1:23:2a, state=Up, lastChangeId=10802 device.gen; productCode=ZUHDDEC, productDescription=Copper Decoder - HDMI 1.4, pid=0x0

device.gen; firmware=1.18

device.optionalPorts; video=none, usb=full, analogAudio=yes, rs232=yes, ir=yes Success

#### **GUI Status**

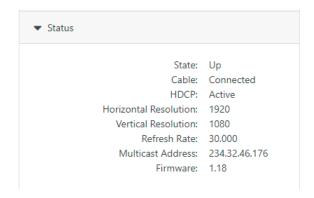

### **Device Grid Status**

ZUHDDEC	1.16	Update	•	active	update_zuh	39
ZUHDDEC	1.18	Update	•	idle	none	0

### **Additional API commands:**

### Packagelist - Prints contents of the most up to date packageList.txt

Zyper\$ packagelist ActivePackageName: , ActivePackageVersion: 1.18 v1Dec: IPD5000\_upgrade\_v2.0.4.18.bin: v2.0.4.18 v1Enc: IPE5000\_upgrade\_v2.0.4.18.bin: v2.0.4.18

v2Dec: IPD5000\_v3.0.3.bin2: v3.0.3 v2Enc: IPE5000\_v3.0.3.bin2: v3.0.3

### Packagerevs - prints all device internal revs

Zyper\$ packagerevs

34:1b:22:80:51:4d: v2.0.4

34:1b:22:80:7c:f1: v2.0.4.18

34:1b:22:f0:0:87: v2.0.4.18

34:1b:22:f0:0:88: v2.0.4.18

34:1b:22:f1:23:19: v2.0.4.18

34:1b:22:f1:23:2a: v2.0.4.18

6c:df:fb:0:2:91: v2.0.2

6c:df:fb:0:2:a3: v1.2.2

6c:df:fb:0:2e:b0: v3.0.3

6c:df:fb:0:2f:da: v1.1.5

6c:df:fb:0:3f:1e: v1.1.9

6c:df:fb:0:46:db: 1.2.0.2

6c:df:fb:0:47:1b: 1.3.2.0

6c:df:fb:0:48:3b: 1.2.0.2

6c:df:fb:0:49:93: 1.3.2.4

6c:df:fb:0:51:96: v3.0.3

6c:df:fb:0:52:60: v3.0.2

6c:df:fb:0:69:b7: 1.3.2.4

6c:df:fb:0:75:5b: v3.0.2

### **Example of the most current Package List file**

#

version: 1.18

v1Enc: IPE5000\_upgrade\_v2.0.4.18.bin: v2.0.4.18 v1Dec: IPD5000\_upgrade\_v2.0.4.18.bin: v2.0.4.18

v2Enc: IPE5000\_v3.0.3.bin2: v3.0.3 v2Dec: IPD5000\_v3.0.3.bin2: v3.0.3

version: 1.17

v1Enc: IPE5000\_upgrade\_v2.0.4.18.bin: v2.0.4.18 v1Dec: IPD5000\_upgrade\_v2.0.4.18.bin: v2.0.4.18

v2Enc: IPE5000\_v2.0.2.bin2: v2.0.2 v2Dec: IPD5000\_v1.2.2.bin2: v1.2.2

version: 1.16

v1Enc: IPE5000\_upgrade\_v2.0.4.bin: v2.0.4 v1Dec: IPD5000\_upgrade\_v2.0.4.bin: v2.0.4 v2Enc: IPE5000\_v2.0.2.bin2: v2.0.2 v2Dec: IPD5000\_v1.1.12.bin2: v1.1.12

version: 1.15

v1Enc: IPE5000\_upgrade\_v2.0.4.bin: v2.0.4 v1Dec: IPD5000\_upgrade\_v2.0.4.bin: v2.0.4 v2Enc: IPE5000\_v2.0.0.bin2: v2.0.0 v2Dec: IPD5000\_v1.1.10.bin2: v1.1.10

version: 1.14

v1Enc: IPE5000\_upgrade\_v2.0.4.bin: v2.0.4 v1Dec: IPD5000\_upgrade\_v2.0.4.bin: v2.0.4

v2Enc: IPE5000 v1.1.9.bin2: v1.1.9 v2Dec: IPD5000 v1.1.9.bin2: v1.1.9 version: 1.13 v1Enc: IPE5000\_upgrade\_v2.0.4.bin: v2.0.4 v1Dec: IPD5000\_upgrade\_v2.0.4.bin: v2.0.4 v2Enc: IPD5000 v1.1.8.bin2: v1.1.8 v2Dec: IPE5000\_v1.1.8.bin2: v1.1.8 version: 1.12 v1Enc: IPE5000\_upgrade\_v2.0.4.bin: v2.0.4 v1Dec: IPD5000\_upgrade\_v2.0.4.bin: v2.0.4 v2Enc: IPE5000\_v1.1.6.bin2: v1.1.6 v2Dec: IPD5000\_v1.1.6.bin2: v1.1.6 version: 1.11 v1Enc: IPE5000\_upgrade\_v2.0.4.bin: v2.0.4 v1Dec: IPD5000\_upgrade\_v2.0.4.bin: v2.0.4 v2Enc: IPE5000\_v1.1.5.bin2: v1.1.5 v2Dec: IPD5000\_v1.1.5.bin2: v1.1.5 version: 1.10 v1Enc: IPE5000\_upgrade\_v2.0.4.bin: v2.0.4 v1Dec: IPD5000\_upgrade\_v2.0.4.bin: v2.0.4 v2Enc: v2Dec: version: 1.9 v1Enc: IPE5000\_upgrade\_v1.2.2.b1.bin: v1.2.2.b1 v1Dec: IPD5000\_upgrade\_v1.2.2.b1.bin: v1.2.2.b1 v2Enc: v2Dec: version: 1.8 v1Enc: IPE5000\_upgrade\_v1.1.2.bin: v1.1.2 v1Dec: IPD5000\_upgrade\_v1.1.2.bin: v1.1.2 v2Enc: v2Dec: version: 1.7 v1Enc: IPE5000\_upgrade\_v0.10.10.p2.bin: v0.10.10.p2 v1Dec: IPD5000\_upgrade\_v0.10.10.p2.bin: v0.10.10.p2 v2Enc: v2Dec: version: 1.6 v1Enc: IPE5000\_upgrade\_v0.10.10.bin: v0.10.10 v1Dec: IPD5000\_upgrade\_v0.10.10.bin: v0.10.10 v2Enc: v2Dec: version: 1.5 v1Enc: IPE5000-B70\_upgrade\_v0.10.3.bin: v0.10.3 v1Dec: IPD5000-B70\_upgrade\_v0.10.2.bin: v0.10.2 v2Enc: v2Dec: version: 1.4 v1Enc: IPE5000-B70\_upgrade\_v0.10.1.bin: v0.10.1 v1Dec: IPD5000-B70\_upgrade\_v0.10.1.bin: v0.10.1

v2Enc: v2Dec: version: 1.3

v1Enc: IPE5000-B70\_upgrade\_v0.9.5.bin: v0.9.5 v1Dec: IPD5000-B70\_upgrade\_v0.9.5.bin: v0.9.5

v2Enc: v2Dec:

version: 1.2

v1Enc: IPE5000-B70\_upgrade\_v0.9.4.bin: v0.9.4 v1Dec: IPD5000\_upgrade\_v0.5.5.bin: v0.5.5

v2Enc: v2Dec:

version: 1.1

v1Enc: IPE5000\_upgrade\_v0.6.1.bin: v0.6.1 v1Dec: IPD5000\_upgrade\_v0.5.5.bin: v0.5.5

v2Enc: v2Dec:

version: 1.0

v1Enc: IPE5000\_upgrade\_v0.5.2.bin: v0.5.2 v1Dec: IPD5000\_upgrade\_v0.5.5.bin: v0.5.5

v2Enc: v2Dec:

### **Important Notes:**

- 1) Devices will show "unknown" if the endpoint device has a newer version of the software that is not included under the current site's package list.
- 2) Devices that receive updates that are already on an internal version included in the package will just update the version.
- 3) If a single device is updated, only that device will show the updated version.

### Cross Platform Redundancy Support

### **Components: Server Qualification**

**Overview:** In this release, we now support Cross Platform redundancy across all server platform types. An extensive testing period was designated during this QA cycle to certify the redundancy platforms on all types of servers.

### The below servers are supported in the following modes.

Primary Server Type	Secondary Server Type	Single NIC (Server Port Only)	Dual NIC (Management Port)
NUC Rev A	NUC Rev A	Yes	No
NUC Rev A	NUC Rev C/D	Yes	No
NUC Rev A	NUC Rev E	Yes	No
NUC Rev A	ProServer	Yes	No
NUC Rev A	VMware MP	Yes	No
NUC Rev C/D	NUC Rev A	Yes	No
NUC Rev C/D	NUC Rev C/D	Yes	No
NUC Rev C/D	NUC Rev E	Yes	No
NUC Rev C/D	ProServer	Yes	No
NUC Rev C/D	VMware MP	Yes	No
NUC Rev E	NUC Rev A	Yes	No
NUC Rev E	NUC Rev C/D	Yes	No

NUC Rev E	NUC Rev E	Yes	Yes
NUC Rev E	ProServer	Yes	Yes
NUC Rev E	VMware MP	Yes	Yes
ProServer	NUC Rev A	Yes	No
ProServer	NUC Rev C/D	Yes	No
ProServer	NUC Rev E	Yes	Yes
ProServer	ProServer	Yes	Yes
ProServer	VMware MP	Yes	Yes
VMware	NUC Rev A	Yes	No
VMware	NUC Rev C/D	Yes	No
VMware	NUC Rev E	Yes	Yes
VMware	ProServer	Yes	Yes
VMware	VMware MP	Yes	Yes

To Qualify each server, redundancy failure was simulated with Power failure, Ethernet Loss, and with the use of a manual Switchover command. All Devices were retested upon failover and verification of functionality was performed after each event.

**Limitations:** During testing of the Ethernet Loss event there is a limitation found that when the Ethernet was restored to the Primary server, it would resume as the Primary role (unless the Preferred master flag is set to false). This is because from the Primary server's point of view the loss to the other server was seen. So, it remains the Primary server under these circumstances.

5 Volt HDMI Control ZyPerXS/XR Decoder, ZyPer4K Display Port Decoder

Components: ZyPerXS/XR Decoders, ZyPer4K Display Port Decoders, API Server

**Overview:** In this release we have added the ability to toggle the 5Volts on the HDMI output for ZyPerXS/XR and ZyPer4K Display Port Decoders. This feature takes effect if the HDMI is removed from the connected Encoder. The Decoder will detect this condition and automatically turn off the 5Volts on its HDMI output.

Special Note: For ZyPerXS/XR it is required that firmware be updated to 1.3.2.4

**Operation:** To enable this feature for the above-mentioned hardware, the below commands can be run in the command API. The default behavior for these Decoders is a "disabled" setting, therefor if the HDMI cable is pulled from the encoder the decoder will not adjust the 5Volts.

Zyper\$ set decoder decoderMAC| decoderName hdmi5vControl

disabled

enabled

**Appearance:** Under the device config output there is a new field for 5Volt toggle.

**Disabled (default) State** 

### **ZyPer4K Display Port Decoder**

device(80:1f:12:4c:20:e8);

device.gen; model=Zyper4K, type=encoder, virtualType=none, name=80:1f:12:4c:20:e8, state=Up, lastChangeId=70 device.gen; productCode=Z4KENCF3, productDescription=Fiber Encoder - HDMI 2.0, pid=0x2

device.gen; firmware=4.1.2.0

device.gen; ethernetManagementPortMode=disabled

device.optionalPorts; video=none, usb=none, analogAudio=yes, rs232=yes, ir=yes

device.hdmi; hdcpMode=enabled, 5vControl=disabled

### **ZyPerXS Decoder**

Zyper\$ show device config db

device(6c:df:fb:0:46:db);

device.gen; model=Zyper4KXS, type=decoder, virtualType=none, name=6c:df:fb:0:46:db, state=Up, lastChangeId=121

device.gen; productCode=Z4KDECCXS, productDescription=Copper Decoder - HDMI 2.0, pid=0x0

device.gen; firmware=1.3.2.4

device.gen; ethernetManagementPortMode=disabled

device.optionalPorts; video=none, usb=hid, analogAudio=yes, rs232=no, ir=no

device.hdmi; hdcpMode=auto, 5vControl=disabled

### **Enabled State**

### **ZyPer4K Display Port Decoder**

device(80:1f:12:4c:20:e8);

device.gen; model=Zyper4K, type=encoder, virtualType=none, name=80:1f:12:4c:20:e8, state=Up, lastChangeId=70

device.gen; productCode=Z4KENCF3, productDescription=Fiber Encoder - HDMI 2.0, pid=0x2

device.gen; firmware=4.1.2.0

device.gen; ethernetManagementPortMode=disabled

device.optionalPorts; video=none, usb=none, analogAudio=yes, rs232=yes, ir=yes

device.hdmi; hdcpMode=enabled, 5vControl=enabled

### **ZyPerXS Decoder**

Zyper\$ show device config db

device(6c:df:fb:0:46:db);

device.gen; model=Zyper4KXS, type=decoder, virtualType=none, name=6c:df:fb:0:46:db, state=Up, lastChangeId=121

device.gen; productCode=Z4KDECCXS, productDescription=Copper Decoder - HDMI 2.0, pid=0x0

device.gen; firmware=1.3.2.4

device.gen; ethernetManagementPortMode=disabled

device.optionalPorts; video=none, usb=hid, analogAudio=yes, rs232=no, ir=no

device.hdmi; hdcpMode=auto, 5vControl=enabled

### Appendix B New CamelCase Replaces Hyphenated Formatting (Introduced in ZMP v2.2 release)

#### Overview

A major effort has been made in 2.2 to make the API more consistent, both input commands and resulting output. Backward compatibility was a critical goal of this effort whenever possible. There are two main mechanisms implemented to assist with backward compatibility:

- Deprecated commands: they will continue to work in 2.2 but will not be included in help or auto-complete.
- CamelCase or hyphenated commands: all commands can be entered either as camelCase or hyphenated. Only camelCase commands are in help and auto-complete.

The result is that all but a very few commands (e.g. load encoderEdid and audio-related parameters) from 2.1 will work in 2.2.

However, there is some API output that has changed. While this is minimal, it may require some changes to third-party applications processing the output.

### CamelCase Commands – 100% Backward Compatible

Commands in 2.1 are mostly hyphenated. A major change in 2.2 is to "default" all command tokens to camelCase. *However, all commands changed to camelCase are 100% backwardly compatible*:

- API Help will show only camelCase command syntax
- API autocompletion will only complete camelCase syntax
- But: API input will still accept the hyphenated commands as defined in 2.1

For example, the following versions of the same command are accepted in 2.2: set decoder dec1 display-size auto set decoder dec1 displaySize auto

### CamelCase Show Output

Most of the output in 2.1 is already camelCase. However, to make the interface as consistent as possible, there are a few tokens that changed to camelCase in 2.2. In most cases, they are fairly obscure output but may require changes in third-party applications.

For more information on the updated CamelCase formatting, please reference the latest version of the **ZyPer Management Platform User Guide** found on our website's documentation page.

https://www.zeevee.com/documentation/